
CONSTRUCTION NOTES:

- 1. PROJECT LIMITS: WORK AND CONTRACTOR ACCESS SHALL BE LIMITED TO BALLROOM AREAS DEFINED ON THIS SHEET EXCEPT FOR CONTRACTOR RESTROOM ACCESS.
- 2. EXISTING FLOOR: WOOD FLOORING HAS BEEN REMOVED BY OWNER IN BALLROOM 3, REMOVE WOOD FLOORING FROM BALLROOMS 1 AND 2 AND ALL ASSOCIATED SUPPORT SPACES/CLOSETS, AND EXISTING WOOD FLOORING ADHESIVE FROM BALLROOMS 1, 2 AND 3 AND ALL ASSOCIATED SUPPORT SPACES/CLOSETS. ADHESIVE REMOVAL TO OCCUR THROUGH MECHANICAL MEANS AS A PART OF THE PREPARATION WORK DESCRIBED IN SECTION 030134.
- REMOVE, REPLACE AND RESET FLOOR CLEAN-OUT COVER (6" COVER) WHERE OCCURS. ASSUME (2) LOCATIONS. MFR: ZURN ZN1400 6" OR EQUAL, BRASS CLEAN OUT, ADJUSTABLE FLUSH FLOOR
- ONLY EXISTING CONTROL JOINTS AND CRACKS WHICH ARE VISIBLE AS A RESULT OF LIMITED OWNER DEMOLITION ARE SHOWN ON THIS DRAWING. ANTICIPATE ADDITIONAL CONTROL JOINTS AND CRACKS. ROUTE AND FILL ALL CONTROL JOINTS AND CRACKS PER 1/A2 AND SECTION 030134 "CONCRETE SURFACE PREPARATION, PATCHING AND RAMPS".



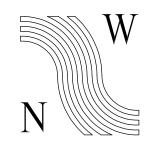

NorthWind Architects LLC

126 Seward Street Juneau, AK 99801 907.586.6150

RENOVATION CENTENNIAL FLOOR

REVISED 15 APRIL, 2017 DWG: DH

REVISED 31 MARCH, 2017

DWG: DH

REVISED 10 JANUARY, 2017 DWG: DH

OVERALL BALLROOM PLAN

DATE: OCTOBER 2016

GRG CHECKED BY: GRG DRAWN:

SHEET#

1/16" = 1'-0"







SEMI RIGID EPOXY JOINT FILLER

FINISH SYSTEM

ROUTE/SAW CUT FOR CLEAN, STRAIGHT

LOCATION ONSITE


CHANNEL

CONTROL JOINTS AND CRACKS
3" = 1'-0"

EXISTING CRACK ALONG EXISTING


CONTROL JOINT IN SLAB - VERIFY

1/4"

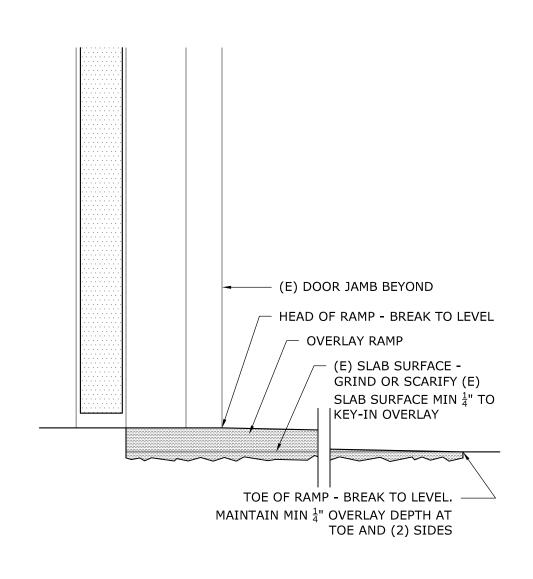

2 RAMPS 3" = 1'-0"

09/29/2016

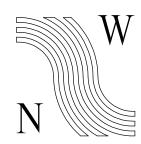

NorthWind Architects LLC

126 Seward Street Juneau, AK 99801 907.586.6150

CENTENNIAL HALL

CONSTRUCTION DOCUMENTS

FLOOR RENOVATION

FLOOR & WALL DETAILS

DATE: OCTOBER 2016 GRG

CHECKED BY:

DRAWN:

SHEET#

GRG

REVISED 31 MARCH, 2017

DWG: DH

REVISED 10 JANUARY, 2017 DWG: DH